

IMG_1704
Taken by: TBM - HNTB @ 11:17 AM on 1/08/19
Design #1617 - Ramp D over Mississippi Blvd.
Location: first splice from south end on west side
Looking SW

note: large gap here
note: total vertical gap = 7/16"

note: *vertical alignment deviation*
fix by shimming this side

note: tight fit here
note: *galvanizing is already flaking off*
repair


NOTE: throughout this document, suggested issues to be addressed / repaired are book ended with *'s as such *xxx xxx xxx*

Taken by: TBM - HNTB @ 11:18 AM on 1/08/19
Design #1617 - Ramp D over Mississippi Blvd.
Location: first splice from south end on east side
Looking east

note: *vertical alignment deviation*
fix by shimming opposite side

note: approx. 1/8" gap here

note: >1/4" gap here
possibly OK

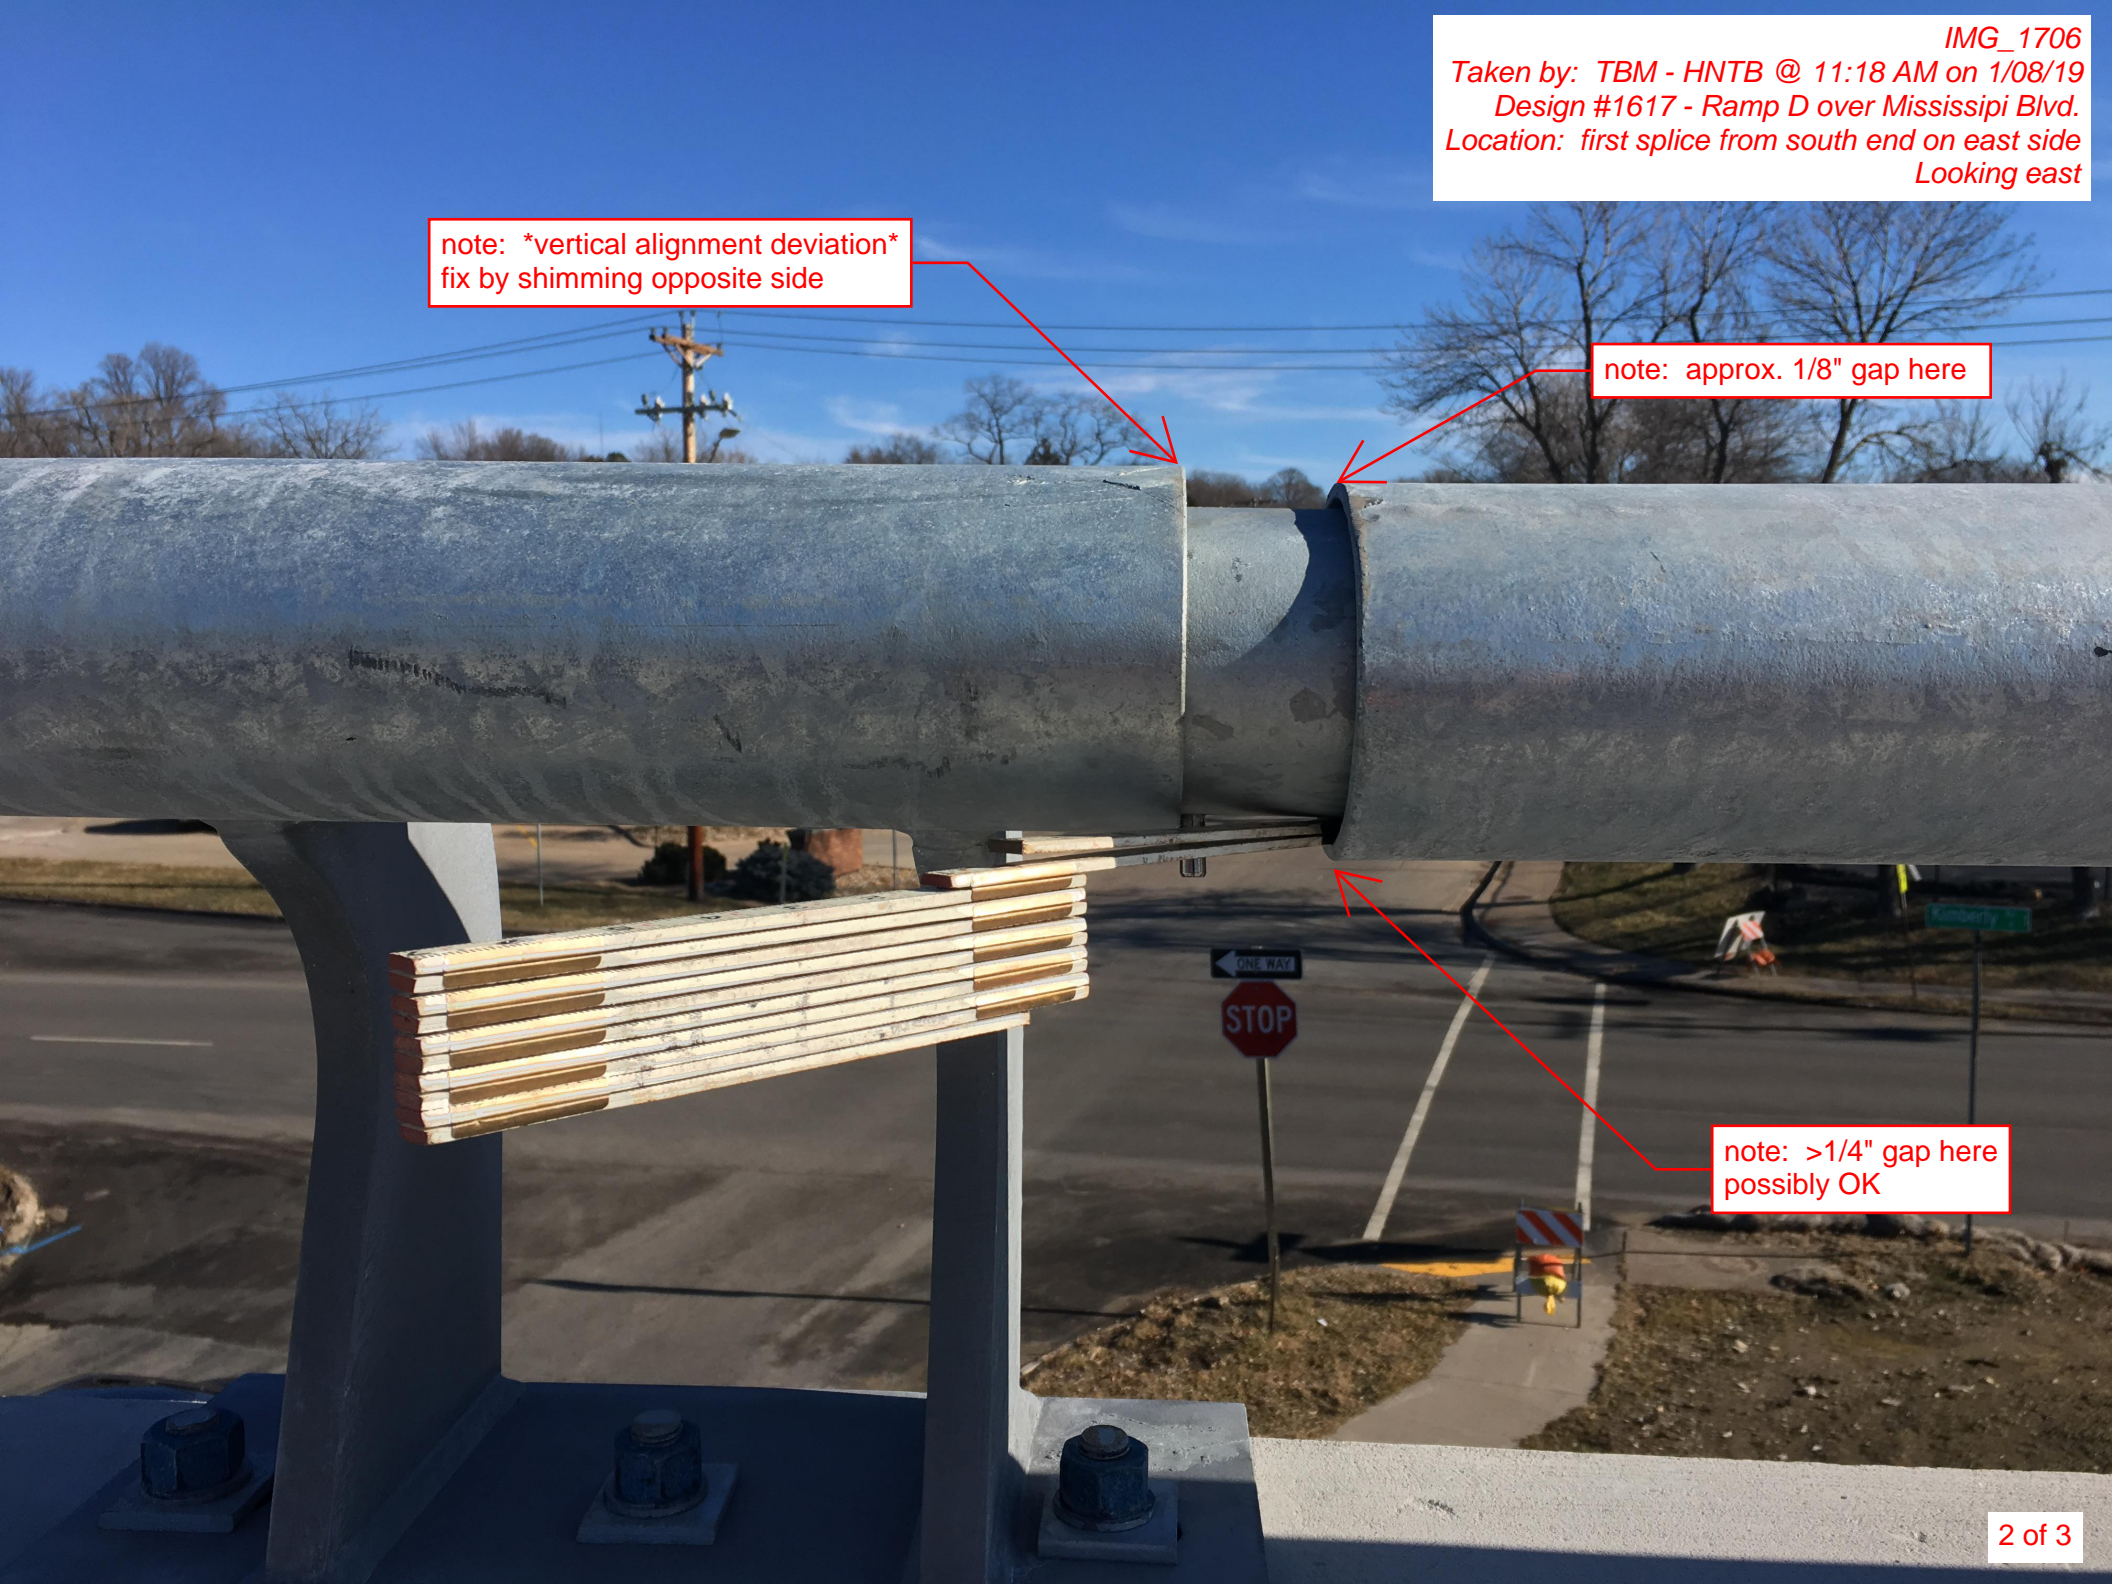

Taken by: TBM - HNTB @ 11:21 AM on 1/08/19
Design #1617 - Ramp D over Mississippi Blvd.
Location: last splice at north end on east side
Looking NE

note: possibly OK vertical gap here

note: *deformation here*
repair or replace

note: *vertical alignment deviation*
fix by shimming opposite side

note: tight fit here

note: large gap on bottom of this side

